

## Series TY-FRL – 5.6 and 8.0 K-factor Upright and Pendent Intermediate Level Sprinklers Quick Response

## General Description

TYCO Series TY-FRL 5.6K and 8.0K Quick Response Upright and Pendent Intermediate Level Sprinklers are automatic sprinklers of the quick response solder type. They are standard spray sprinklers intended for use in fire sprinkler systems designed in accordance with the standard installation rules recognized by the applicable listing or approval agency, for example, UL Listing is based on NFPA requirements. Both the Pendent and Upright Sprinklers produce a hemispherical water distribution pattern below the deflector.

Intermediate level sprinklers are primarily designed for use in rack storage sprinkler systems where their thermally sensitive elements must be shielded from the water spray of higher elevation sprinklers that could operate earlier during a fire. Intermediate level sprinklers are also used in other applications such as beneath open gridded catwalks.

### NOTICE

The Series TY-FRL Sprinklers described herein must be installed and maintained in compliance with this document, as well as with the applicable standards of the National Fire Protection Association (NFPA), in addition to the standards of any other authorities having jurisdiction. Failure to do so may impair the performance of these devices.

The owner is responsible for maintaining their fire protection system and devices in proper operating condition. Contact the installing contractor or product manufacturer with any questions.

## Sprinkler Identification Numbers (SINs)

TY3123... Upright 5.6K, 1/2 in. NPT TY3221...Pendent 5.6K, 1/2 in. NPT TY4123... Upright 8.0K, 3/4 in. NPT TY4221...Pendent 8.0K, 3/4 in. NPT TY3123 is a redesignation for Star SIN S1991 and Gem

SIN G8986 TY3221 is a redesignation for Star SIN S1865 and Gem SIN G8972

TY4123 is a redesignation for Star SIN S1993 and Gem SIN G8153

TY4221 is a redesignation for Star SIN S1867 and Gem SIN G8172  $\,$ 





### Technical Data

Approvals UL and C-UL Listed FM and NYC Approved

(See Table A for complete approval information.)

Maximum Working Pressure 175 psi (12,1 bar)

**Discharge Coefficients** 

K=5.6 gpm/psi<sup>1/2</sup> (80,6 Lpm/bar<sup>1/2</sup>) K=8.0 gpm/psi<sup>1/2</sup> (115,2 Lpm/bar<sup>1/2</sup>)

Temperature Ratings See Table A

**Finishes** See Table A

#### **Physical Characteristics**


FrameBronze
Strut
DeflectorBronze
Hook MONEL
Link Assembly Nickel
Ejection Spring INCONEL
Button
SealTEFLON
ShieldBrass
0

### IMPORTANT

Refer to Technical Data Sheet TFP2300 for warnings pertaining to regulatory and health information.

Always refer to Technical Data Sheet TFP700 for the "INSTALLER WARNING" that provides cautions with respect to handling and installation of sprinkler systems and components. Improper handling and installation can permanently damage a sprinkler system or its components and cause the sprinkler to fail to operate in a fire situation or cause it to operate prematurely.

### **TFP355** Page 2 of 4

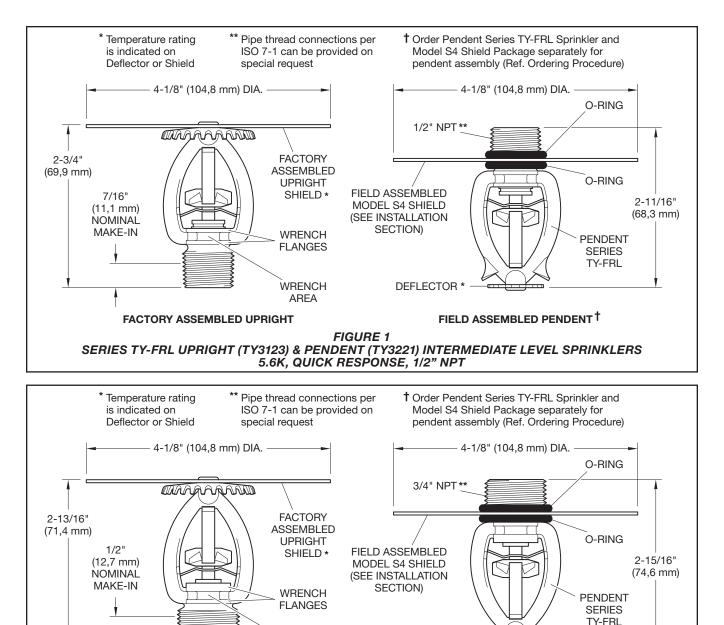

# Design Criteria

TYCO Series TY-FRL 5.6K and 8.0K Quick Response Upright and Pendent Intermediate Level Sprinklers are intended for fire protection systems designed in accordance with the standard installation rules recognized by the applicable listing or approval agency (such as UL Listing is based on the requirements of NFPA 13, and FM Approval is based on the requirements of FM Approvals' Loss Prevention Data Sheets).

FIGURE 2 SERIES TY-FRL UPRIGHT (TY4123) & PENDENT (TY4221) INTERMEDIATE LEVEL SPRINKLERS 8.0K, QUICK RESPONSE, 3/4" NPT

**DEFLECTOR \*** 

WRENCH

AREA

FACTORY ASSEMBLED UPRIGHT

## **Operation**

FIELD ASSEMBLED PENDENT<sup>†</sup>

The fusible link (heat collector) assembly is comprised of two halves that are joined together by a thin layer of solder. When the rated temperature is reached, the solder melts and the two link halves separate, allowing the sprinkler to operate.

K-FACTOR	SPRINKLER TYPE	TEMPERATURE RATING	FRAME COLOR CODE	SPRINKLER FINISH	
				NATURAL BRASS	CHROME PLATED
5.6 1/2 in. NPT	Upright (TY3123) & Pendent (TY3221)	- 165°F (74°C)	Unpainted	1, 2, 3, 4	
8.0 3/4 in. NPT	Upright (TY4123) & Pendent (TY4221)				

Notes:

1. Listed by Underwriters Laboratories, Inc. (UL) as quick response sprinklers

2. Listed by Underwriters Laboratories, Inc. for use in Canada (C-UL) as quick response sprinklers

Approved by FM Global (FM Approvals) as quick response sprinklers
Approved by the City of New York (NYC) under MEA 112-04-E

#### TABLE A

5.6K & 8.0K SERIES TY-FRL UPRIGHT & PENDENT INTERMEDIATE LEVEL SPRINKLERS, QUICK RESPONSE LABORATORY LISTINGS AND APPROVALS

### Installation

TYCO Series TY-FRL 5.6K and 8.0K Quick Response Upright and Pendent Intermediate Level Sprinklers must be installed in accordance with this section

#### **General Instructions**

A leak-tight 1/2 in. NPT sprinkler joint should be obtained with a torque of 7 to 14 lb-ft (9,5 to 19,0 N·m). A leak-tight 3/4 in. NPT sprinkler joint should be obtained with a torgue of 10 to 20 lb-ft (13,4 to 26,8 N·m). Higher levels of torque may distort the sprinkler inlet and cause leakage or impairment of the sprinkler.

#### **Upright Sprinklers**

The Series TY-FRL Intermediate Level Upright Sprinklers must be installed in accordance with the following instructions:

Step 1. With pipe thread sealant applied to the pipe threads, handtighten the sprinkler into the sprinkler fitting.

Step 2. Tighten the sprinkler into the sprinkler fitting using only the W-Type 9 Sprinkler Wrench, see Figure 3. With reference to Figure 1 or 2, the W-Type 9 Sprinkler Wrench is to be applied to the wrenching area.

#### **Pendent Sprinklers**

The Series TY-FRL Intermediate Level Pendent Sprinklers must be installed in accordance with the following instructions:

Step 1. Install an O-ring over the sprinkler threads until it seats against the sprinkler wrenching area flange as shown in Figure 1 or 2, as applicable.

Step 2. Install the Model S4 Shield over the sprinkler threads, and then roll the O-ring over the sprinkler threads until it is seated firmly against the shield.

Step 3. With pipe thread sealant applied, hand-tighten the sprinkler into the sprinkler fitting.

Step 4. Tighten the sprinkler into the sprinkler fitting using only the W-Type 9 Sprinkler Wrench, see Figure 3. The wrench is to be applied to the sprinkler wrenching area shown in Figure 1 or 2, as applicable.

When installed correctly, the O-ring will be slightly compressed and the shield will be held firmly in place.

### Care and Maintenance


TYCO Series TY-FRL 5.6K and 8.0K Quick Response Upright and Pendent Intermediate Level Sprinklers must be maintained and serviced in accordance with this section.

Before closing a fire protection system control valve for maintenance work on the fire protection system that it controls, permission to shut down the affected fire protection system must be obtained from the proper authorities and all personnel who may be affected by this action must be notified.

Sprinklers that are found to be leaking or exhibiting visible signs of corrosion must be replaced.

Automatic sprinklers must never be painted, plated, coated or otherwise altered after leaving the factory. Modified sprinklers must be replaced. Sprinklers that have been exposed to corrosive products of combustion, but have not operated, should be replaced if they cannot be completely cleaned by wiping the sprinkler with a cloth or by brushing it with a soft bristle brush.

Care must be exercised to avoid damage to the sprinklers before, during, and after installation. Sprinklers damaged by dropping, striking,

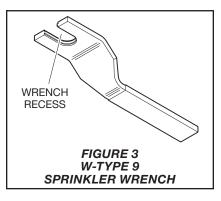


wrench twist/slippage, or the like, must be replaced. Also, replace any sprinkler that has a cracked bulb or that has lost liquid from its bulb, see Installation Section.


The owner is responsible for the inspection, testing, and maintenance of their fire protection system and devices in compliance with this document, as well as with the applicable standards of the National Fire Protection Association, such as NFPA 25, in addition to the standards of any other authorities having jurisdiction. Contact the installing contractor or sprinkler manufacturer with any questions.

It is recommended that automatic sprinkler systems be inspected, tested, and maintained by a gualified Inspection Service in accordance with local requirements and/or national codes.

### **TFP355** Page 4 of 4

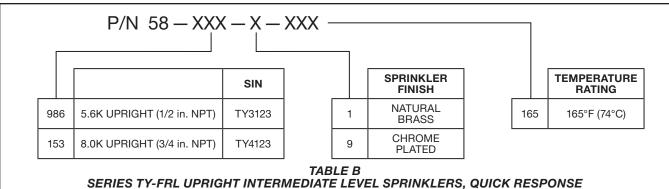

PART NUMBER SELECTION

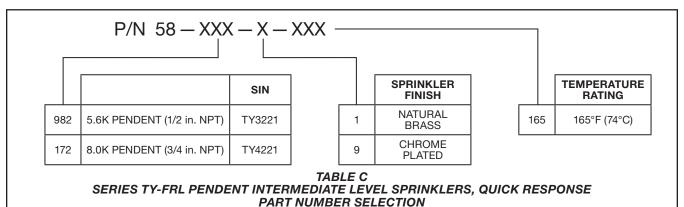

(MODEL S4 PENDENT SHIELD, SPEED-NUT AND O-RING MUST BE SEPARATELY ORDERED)

## Limited Warranty

For warranty terms and conditions, visit www.tyco-fire.com.

## **Orderina Procedure**

Contact your local distributor for availability. When placing an order, indicate the full product name, including description and part number (P/N).

#### **Upright Sprinkler Assemblies with** NPT Thread Connections (with Shield)

Specify: Series TY-FRL Upright Intermediate Level Sprinkler, (specify K-factor), Quick Response, (specify) temperature rating, (specify) finish, P/N (See Table B)

### Pendent Sprinkler Assemblies with **NPT Thread Connections**

(Shield ordered separately) Specify: Series TY-FRL Pendent Sprinkler, (specify K-factor), Quick Response, (specify) temperature rating, (specify) finish, P/N (See Table C)

#### Model S4 Sprinkler Shield

Includes S4 Shield and two O-Rings.

Specify: Model S4 Sprinkler Shield, (specify) finish, (specify) Thread Size, P/N (specify):

### Plain Brass

Ohmenne Dieterd							
3/4 in. NPT	56-152-1-001						
1/2 in. NPT	56-952-1-001						

Chrome Plated						
1/2 in. NPT	56-951-9-001					
3/4 in. NPT						

#### Sprinkler Wrench

Specify: W-Type 9 Sprinkler Wrench, P/N 56-000-1-8499

#### **Replacement O-Ring**

Specify: Model S4 Sprinkler Shield Replacement O-Ring, P/N 62-578-1-118

Note: Part Number is for one O-Ring. Two O-Rings are required for installing a Series TY-FRL Pendent Sprinkler with Model S4 Sprinkler Shield.



1400 Pennbrook Parkway, Lansdale, PA 19446 | Telephone +1-215-362-0700

© 2020 Johnson Controls. All rights reserved. All specifications and other information shown were current as of document revision date and are subject to change without notice. NATIONAL FIRE PROTECTION ASSOCIATION and NFPA are registered trademarks of National Fire Protection Association; MONEL and INCONEL are registered trademarks of Special Metals Corporation; TEFLON is a registered trademark of DuPont